KEYNOTES

16.032 CONNECT TO POWER POLE ORANGE TWIST-LOCK.

16.145 CONNECT CIRCUIT(S) TO EXISTING BRANCH CIRCUITRY. MINIMUM WIRE SIZE AND PANELBOARD CIRCUIT ARE NOTED. VERIFY SIZE, RATING AND CONDITION OF EXISTING BRANCH CIRCUIT CONDUIT AND WIRE PRIOR TO USE TO ENSURE THAT THEY MEET REQUIRED SIZE, AND ALL U.L. RATINGS AND REPLACE AS REQUIRED.

16.489 RELOCATE, EXTEND, AND RECONNECT CIRCUITRY AND ELECTRICAL DEVICES FOR RELOCATED AND/OR NEW EQUIPMENT. VERIFY CONDITION OF BRANCH CIRCUITRY, CONDUIT AND WIRE TO ENSURE THEY MEET ALL U.L. RATINGS AND REPLACE AS REQUIRED. VERIFY FINAL LOCATION OF RELOCATED/NEW EQUIPMENT WITH WALMART CONSTRUCTION MANAGER PRIOR TO ROUGH-IN.

16.492 E.C. SHALL COORDINATE WITH GENERAL CONTRACTOR AND ARCHITECTURAL DEMOLITION PLANS THE EXTENT OF ELECTRICAL DEMOLITION. REMOVE UNUSED DEVICES, BOXES, CONDUITS, AND WIRING BACK TO ORIGINATING JUNCTION BOXES OR PANELBOARDS. REFERENCE POWER PLANS FOR CIRCUITRY TO BE REUSED. DEMOLITION SHALL NOT AFFECT ACTIVE CIRCUITS. IF CIRCUIT IS DISCONTINUED ALL THE WAY TO PANELBOARD, REMOVE CIRCUIT BREAKER AND REPLACE WITH FILLER PLATE. UPDATE TYPEWRITTEN CIRCUIT DIRECTORY IDENTIFYING CIRCUIT AS "SPACE". COORDINATE EXACT REQUIREMENTS WITH EXISTING CONDITIONS PRIOR TO BID.

16.507 MENU TV'S: MOUNT JUNCTION BOX AT STRUCTURE. AFTER INSTALLATION OF DROP POLE AND TV COMPONENT TRAY, EXTEND CONDUCTORS IN ½" FLEXIBLE METAL CONDUIT, ROUTED INSIDE DROP POLE, TO TV COMPONENT TRAY. PROVIDE 120V, 20A DUPLEX RECEPTACLE ON TV COMPONENT TRAY AND MAKE FINAL TERMINATIONS. COORDINATE TV LOCATIONS WITH STORE SETUP SUPERVISOR.

16.775A E.C. SHALL DISCONNECT, EXTEND, AND RECONNECT ALL ELECTRICAL CIRCUITRY AND LOW VOLTAGE RACEWAYS. LABEL ALL ASSOCIATED PANELBOARD SCHEDULES TO REFLECT SYSTEM NUMBERS AND LOAD DESCRIPTION. VERIFY CONDITION OF BRANCH CIRCUIT, CONDUIT, AND WIRE PRIOR TO USE TO ENSURE THAT THEY MEET ALL U.L. RATINGS AND REPLACE AS REQUIRED. COORDINATE THIS PROCESS WITH CONSTRUCTION MANAGER TO MINIMIZE DOWNTIME.

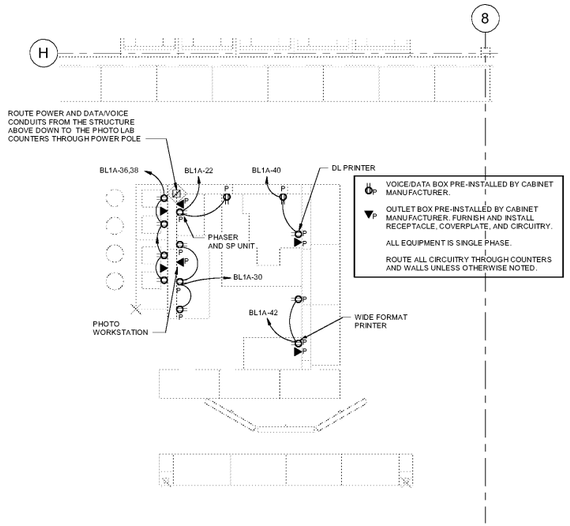

3 PHOTO LAB POWER PLAN
1/4" = 1'-0"

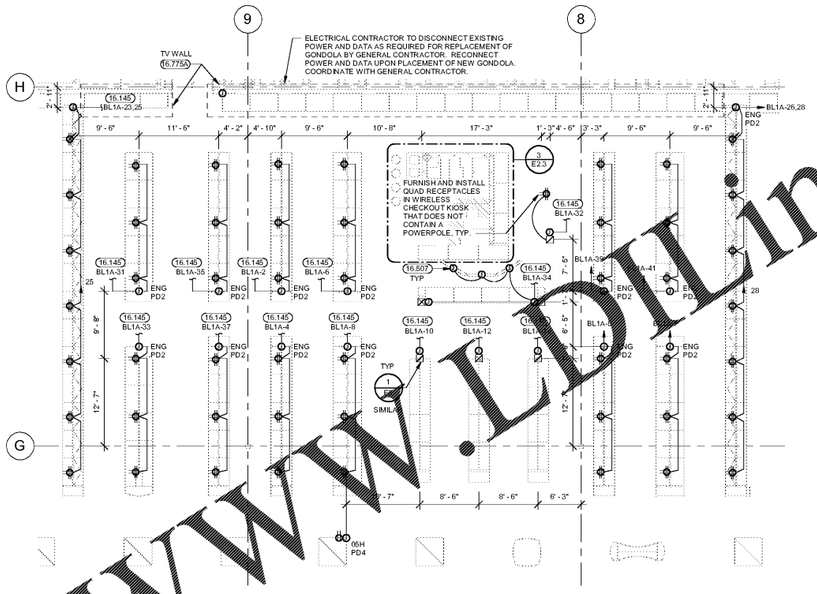

2 ELECTRONICS POWER PLAN
1/8" = 1'-0"

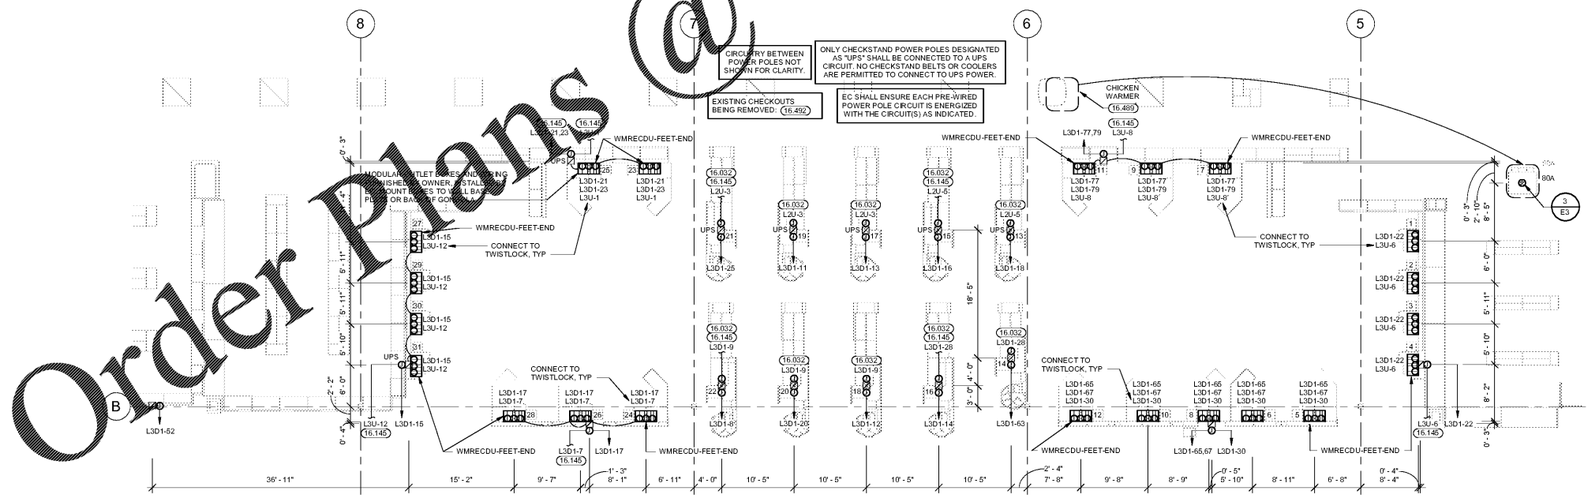

1 FRONT CHECKOUT POWER PLAN
1/8" = 1'-0"

Order Plans @ WWW.LDLine.com

WILLIAM R. WINSTON

CONSULTANTS
HENDERSON ENGINEERS
1900 28TH AVENUE SOUTH, SUITE 200
HOMEWOOD, AL 35209
TEL: (1-)-(1-)-(1-)-(1-) FAX: (1-)-(1-)-(1-)-(1-)
WWW.HENDERSONENGINEERS.COM
AL CORPORATE REG. CA-0185-E
EXPIRES: 12/31/2020

STIPULATION FOR REUSE
THESE DRAWINGS AND SPECIFICATIONS ARE AND SHALL REMAIN THE PROPERTY OF HENDERSON ENGINEERS AL, P.C. AND ARE NOT TO BE USED IN WHOLE OR IN PART FOR ANY PURPOSE OR PROJECT OTHER THAN THE SPECIFIC PROJECT FOR WHICH THEY WERE PREPARED AND PUBLISHED. ANY REUSE WITHOUT WRITTEN VERIFICATION OR ADAPTATION BY HENDERSON ENGINEERS AL, P.C. FOR THE SPECIFIC PURPOSE INTENDED WILL BE AT OWNER'S SOLE RISK AND WITHOUT LIABILITY OR LEGAL EXPOSURE TO HENDERSON ENGINEERS AL, P.C. AND OWNER SHALL INDEMNIFY AND HOLD HARMLESS HENDERSON ENGINEERS AL, P.C. AND ITS OFFICERS AND EMPLOYEES FROM ALL CLAIMS, DAMAGES, LOSSES AND EXPENSES ARISING OUT OF OR RESULTING THEREFROM. ANY SUCH VERIFICATION OR ADAPTATION WILL ENTITLE HENDERSON ENGINEERS AL, P.C. TO FURTHER COMPENSATION AT RATES TO BE AGREED UPON BY OWNER AND HENDERSON ENGINEERS AL, P.C. BEFORE ACQUISITION OF THE INFORMATION OR PERFORMANCE OF THE SERVICES.

Walmart
PRATTVILLE, AL
1000 COBBS FORD ROAD
STORE NO. 00485-249
JOB NUMBER: 2180300485 | PROTO: 188
2021 MAJOR PROJECT

ISSUE BLOCK

CHECKED BY:	MM
DRAWN BY:	SBH/DP
PROTO CYCLE:	01/29/21
DOCUMENT DATE:	03/01/21

ALABAMA LICENSED PROFESSIONAL ENGINEER No. 39436-E WILLIAM RAY WINSTON
03/30/2021

ENLARGED POWER PLANS

SHEET: E2.3

EXISTING CONDITIONS WERE TAKEN FROM ORIGINAL DRAWINGS AND MAY NOT REFLECT EXACT "AS-BUILT" CONDITIONS. CONTRACTOR SHALL FIELD VERIFY ALL EXISTING CONDITIONS PRIOR TO SUBMITTING FINAL BIDS. CONTRACTOR SHALL CAREFULLY COORDINATE NEW WORK AND DEMOLITION WITH ALL OTHER DISCIPLINES AND EXISTING CONDITIONS.

EACH SUBCONTRACTOR IS RESPONSIBLE FOR HAVING A THOROUGH KNOWLEDGE OF ALL DRAWINGS AND SPECIFICATIONS IN THEIR RELATED FIELD. THE FAILURE TO ACQUAINT THEMSELF WITH THIS KNOWLEDGE DOES NOT RELIEVE THE RESPONSIBILITY OF PERFORMING THE WORK PROPERLY. NO ADDITIONAL COMPENSATION SHALL BE ALLOWED BECAUSE OF CONDITIONS THAT OCCUR DUE TO FAILURE TO FAMILIARIZE WORKERS WITH THIS KNOWLEDGE.