


DEMOLITION NOTES BY SYMBOL

- 1 REMOVE A 4'-0" SECTION OF FRONT CHECKOUT COUNTER AND SHELVING DISPLAY BELOW.
- 2 REMOVE FRONT CHECKOUT GATE.
- 3 MILLWORK AND EQUIPMENT TO BE REMOVED AND RELOCATED FROM PHOTOLAB AREA. RELOCATE AS SHOWN ON SHEET F1P.
- 4 PHOTOLAB SINK TO BE REMOVED, PLUMBING TO BE CAPPED OFF.
- 5 DOOR AND HARDWARE TO BE REMOVED. FILL IN HOLES OF DOOR FRAME.
- 6 PHARMACY GATE TO BE REMOVED AND REPLACED WITH NEW GATE.
- 7 REMOVE PHARMACY CHECKOUTS.
- 8 REMOVE CONSULTATION AND DROP-OFF STATIONS.
- 9 REMOVE PHARMACY WAITING CHAIRS, GRAPHICS, AND ALL FINISHES ON WALLS.
- 10 RELOCATE BLOOD PRESSURE MACHINE AS SHOWN ON SHEET F1P.
- 11 ALL MERCHANDISE FIXTURES TO BE REMOVED TO INSTALL NEW CARPET. MERCHANDISE FIXTURES SHOWN DASHED TO BE RELOCATED AND/OR REMOVED AS SHOWN ON SHEET F1P.
- 12 REMOVE COOLER FROM R_x WAITING AREA.
- 13 ATM MACHINE TO BE RELOCATED.
- 14 COUPON CENTER/PRICE SCANNING MACHINE TO BE REPLACED AND RELOCATED.
- 15 ALL TOILET FIXTURES AND ACCESSORIES TO BE REMOVED FROM EACH RESTROOM FOR REMOVAL OF FINISHES ON WALLS. REFER TO SHEET A4 FOR NEW OR REUSED FIXTURES AND ACCESSORIES. IF GYPSUM WALL BOARD IS DAMAGED WHEN REMOVING FINISHES IT IS TO BE REPLACED.
- 16 REMOVE AND RELOCATE DOOR FRAME, DOOR AND HARDWARE.
- 17 REMOVE WALL SHOWN HATCHED.
- 18 REMOVE CARPET FROM RETAIL COLUMNS. SAND, PATCH AND PAINT ENTIRE COLUMN. **[T20]**
- 19 RELOCATE FIRE EXTINGUISHER.
- 20 REMOVE FRONT LINE WORKSTATION RED SHELVES, AND INSTALL NEW PROTOTYPICAL COLOR.

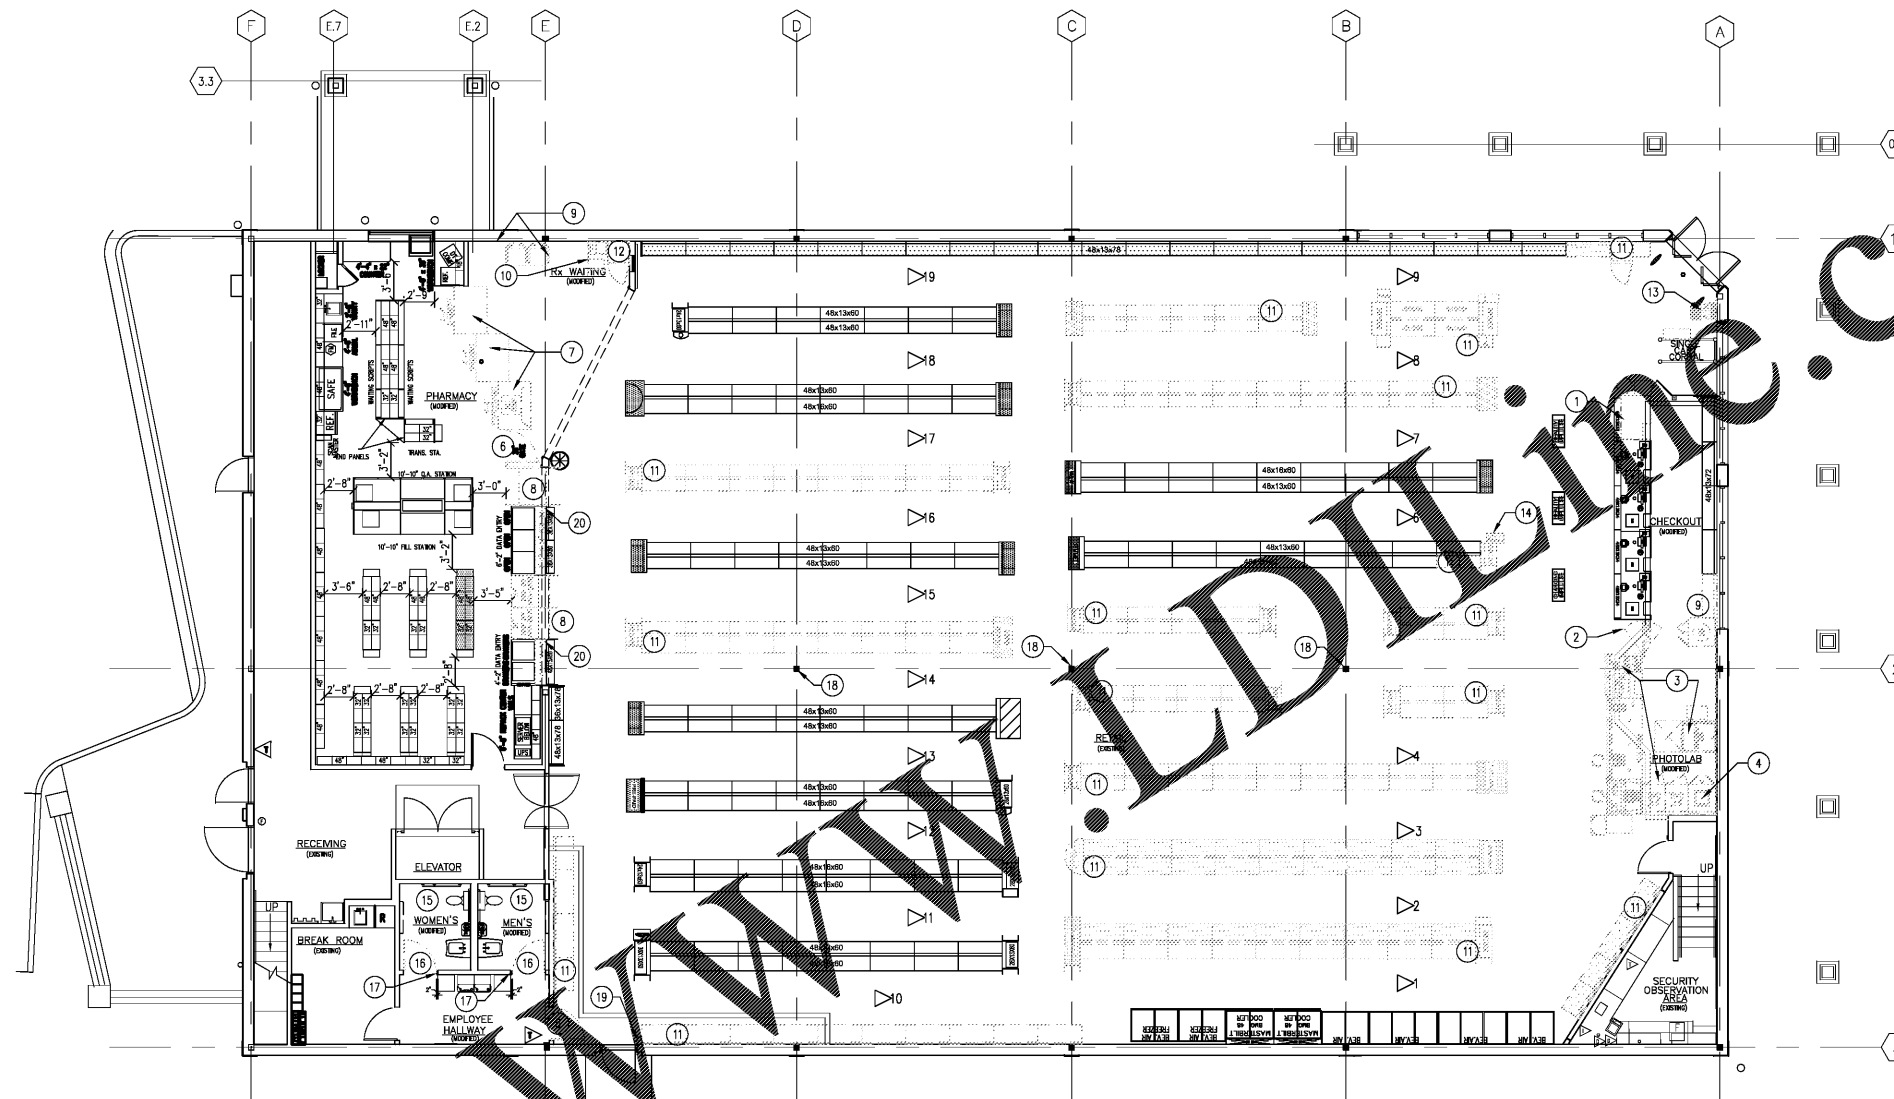

1 DEMOLITION PLAN
AD1 SCALE: 1/8" = 1'-0"

ADA SCOPE OF WORK

REST ROOMS AND HALLWAY:

- MEN'S RESTROOM:**
- PULL SIDE MANEUVERING CLEARANCE AT DOORWAY IS LESS THAN REQUIRED. REMOVE EXISTING LAVATORY AND REPLACE WITH SHALLOWER LAVATORY AT AT LEAST 17" MINIMUM DEEP TO PROVIDE REQUIRED ACCESS. REPAIR FINISH AS NEEDED.
 - DOOR CLOSER CAUSES DOOR TO TRAVEL FROM 90° OPEN TO 12" FROM LATCH IN LESS THAN 5 SECONDS AND/OR EXCEEDS THE MAXIMUM FORCE TO OPEN (5#). ADJUST SURFACE-MOUNTED OVERHEAD CLOSER TO PROVIDE COMPLIANT SPEED AND FORCE. MAY INHIBIT PROPER LATCHING. IF SO, REPLACE EXISTING CLOSER WITH COMPLIANT MODEL WHICH ALLOWS DOOR TO OPERATE AS INTENDED.
 - REAR GRAB BAR IS MOUNTED LESS THAN 1 1/2" FROM THE WATER CLOSET. RAISE THE EXISTING GRAB TO A MAXIMUM OF 36" TO TOP OF GRIPPING SURFACE. CONFIRM THAT WALL OR PARTITION AFFORDS THE REQUIRED STRENGTH AT NEW HEIGHT.
 - VERTICAL GRAB BAR NOT PROVIDED. INSTALL 18" MINIMUM LONG VERTICAL GRAB BAR WITH BOTTOM OF BAR 36" AFF MINIMUM AND 41" AFF MAXIMUM AND WITH CENTERLINE OF BAR LOCATED 36" MINIMUM AND 41" MAXIMUM FROM REAR WALL.
 - TOILET PAPER DISPENSER IS BROKEN. REMOVE EXISTING NON-COMPLIANT TOILET PAPER DISPENSER AND INSTALL NEW COMPLIANT TYPE LOCATED WITHIN COMPLIANT REACH RANGES (LOCATED BELOW THE GRAB BAR AND WITHIN COMPLIANT LOCATION MEASURED FROM THE BACK WALL AND/OR WITHIN COMPLIANT LOCATION IN FRONT OF THE WATER CLOSET). PATCH AND REPAIR AS NEEDED.
 - WATER CLOSET CLEAR FLOOR SPACE OBSTRUCTED BY TRASH CAN. REMOVE PORTABLE TRASH CAN AND INSTALL WALL-MOUNTED OR RECESSED TRASH CONTAINER. COORDINATE WITH REAR RANGE AND CLEAR FLOOR SPACE REQUIREMENTS.
 - TOILET ROOM PROVIDES PAPER TOWEL DISPENSER AND NOT A HAND DRYER. REMOVE PAPER TOWEL DISPENSER AND REPLACE WITH A HAND DRYER. REPAIR FINISHES AS NEEDED.
 - HEIGHT OF WORK SURFACE AT BABY CHANGING TABLE IS GREATER THAN 34" AFF. LOWER EXISTING BABY CHANGING TABLE. LOWER EXISTING BABY CHANGING TABLE TO COMPLIANT TABLE HEIGHT. ENSURE HANDLE IS ALSO WITHIN COMPLIANT REACH RANGES. REPAIR/REFINISH AS NEEDED.
- WOMEN'S RESTROOM:**
- PULL SIDE MANEUVERING CLEARANCE AT DOORWAY IS LESS THAN REQUIRED. REMOVE EXISTING LAVATORY AND REPLACE WITH SHALLOWER LAVATORY AT AT LEAST 17" MINIMUM DEEP TO PROVIDE REQUIRED ACCESS. REPAIR FINISH AS NEEDED.
 - DOOR CLOSER CAUSES DOOR TO TRAVEL FROM 90° OPEN TO 12" FROM LATCH IN LESS THAN 5 SECONDS AND/OR EXCEEDS THE MAXIMUM FORCE TO OPEN (5#). ADJUST SURFACE-MOUNTED OVERHEAD CLOSER TO PROVIDE COMPLIANT SPEED AND FORCE. MAY INHIBIT PROPER LATCHING. IF SO, REPLACE EXISTING CLOSER WITH COMPLIANT MODEL WHICH ALLOWS DOOR TO OPERATE AS INTENDED.
 - TOILET PAPER DISPENSER IS BROKEN. REMOVE EXISTING NON-COMPLIANT TOILET PAPER DISPENSER AND INSTALL NEW COMPLIANT TYPE LOCATED WITHIN COMPLIANT REACH RANGES (LOCATED BELOW THE GRAB BAR AND WITHIN COMPLIANT LOCATION MEASURED FROM THE BACK WALL AND/OR WITHIN COMPLIANT LOCATION IN FRONT OF THE WATER CLOSET). PATCH AND REPAIR AS NEEDED.
 - WATER CLOSET CLEAR FLOOR SPACE OBSTRUCTED BY TRASH CAN. REMOVE PORTABLE TRASH CAN AND INSTALL WALL-MOUNTED OR RECESSED TRASH CONTAINER. COORDINATE WITH REAR RANGE AND CLEAR FLOOR SPACE REQUIREMENTS.
 - TOILET ROOM PROVIDES PAPER TOWEL DISPENSER AND NOT A HAND DRYER. REMOVE PAPER TOWEL DISPENSER AND REPLACE WITH A HAND DRYER. REPAIR FINISHES AS NEEDED.
 - HEIGHT OF WORK SURFACE AT BABY CHANGING TABLE IS GREATER THAN 34" AFF. LOWER EXISTING BABY CHANGING TABLE. LOWER EXISTING BABY CHANGING TABLE TO COMPLIANT TABLE HEIGHT. ENSURE HANDLE IS ALSO WITHIN COMPLIANT REACH RANGES. REPAIR/REFINISH AS NEEDED.

RETAIL:

- AT DOOR BETWEEN RECEIVING AND RECEIVING, NO DIRECTIONAL INDICATING LOCATION OF NEAREST ACCESSIBLE MEANS OF EGRESS. INSTALL COMPLIANT EXIT SIGN IN ACCESSIBLE MEANS OF EGRESS THAT INDICATES THE LOCATION OF THE NEAREST ACCESSIBLE MEANS OF EGRESS. AN EXIT SIGN IS NOT ON THE RECEIVING SIDE.
- AT LOCKED GLASS DISPLAY SHELVES, CUSTOMER SERVICE BUTTON IS OUTSIDE OF REACH RANGE. RELOCATE EXISTING CUSTOMER SERVICE BUTTON TO BE WITHIN COMPLIANT REACH RANGE: 15" MINIMUM, 48" MAXIMUM AFF.
- PHOTO-LAB CHECKOUT OBSTRUCTED BY MERCHANDISE AND CREDIT CARD READER. IN REQUIRED MINIMUM CLEAR LENGTH. RELOCATE CREDIT CARD READER/POINT-OF-SALE MACHINE TO PROVIDE AT LEAST 30"/36" CLEAR LENGTH.
- AT BETWEEN RESTROOMS HALLWAY AND RETAIL AREA, R_x EXIT SIGN IS MISSING. REMOVE DOOR. PATCH AND PAINT FRAME AND REPAIR FINISHES AS NEEDED.
- REQUIRED EXIT SIGN IS MISSING AT CVS MAIN ENTRY AND EMERGENCY EXIT. PLACE SIGN TO THE RIGHT OF SLIDING DOORS ON THE ADJACENT WALL. RELOCATE MERCHANDISE IF NECESSARY. EMERGENCY EGRESS DOORS (SINGLE DOOR): PLACE SIGN TO THE RIGHT OF THE DOOR AT THE LATCH SIDE OR IF NO SPACE, THEN PLACE SIGN NEAR DOOR ON NEAREST ADJACENT WALL. IF DOOR SWINGS OUTWARD, HAS A CLOSER, AND DOES NOT HAVE A HOLD-OPEN DEVICE, PLACE SIGN ON THE PUSH-SIDE OF THE DOOR PANEL AT REAR DOOR. ADD A SIGN INDICATING WHERE THE NEAREST ACCESSIBLE EXIT DOOR IS.
- REMOVE DOOR BETWEEN RETAIL AND RESTROOM HALLWAY.
- AT EMERGENCY EXIT DOOR, FIRE EXTINGUISHER IS OUTSIDE REACH RANGE (15" MINIMUM TO 48" MAXIMUM AFF FOR FORWARD AND PARALLEL APPROACH. RELOCATE OR LOWER FIRE EXTINGUISHER WITHIN REACH RANGE. REPAIR/REFINISH AS NEEDED. IF FIRE EXTINGUISHER IS LOCATED AT AN EXIT/ENTRANCE, VERIFY WITH LOCAL BUILDING CODES WHERE IT CAN BE RELOCATED.
- COUPON/PRICE SCANNING MACHINE IS OUTSIDE OF REACH RANGE ABOVE 48" AFF. REPLACE UNIT WITH A COMPLIANT MODEL WITH CONTROLS THAT ARE IN REACH RANGE AND WITH A VIEWING SCREEN THAT IS AT THE REQUIRED HEIGHT.
- PHARMACY PICK UP COUNTER IS OBSTRUCTED BY CREDIT CARD READER. RELOCATE CREDIT CARD READER/POINT-OF-SALE MACHINE TO PROVIDE AT LEAST 30"/36" CLEAR LENGTH.
- FRONT CHECKOUT SALES COUNTER CLEAR FLOOR SPACE OBSTRUCTED BY TIRED SHELVES. REMOVE A 48" SECTION OF COUNTER AND SHELVING DISPLAY BELOW AND INSTALL A 48" LONG SECTION OF ADA COMPLIANT COUNTER. INSTALL COMPLIANT SIGNAGE INCORPORATING THE INTERNATIONAL SYMBOL OF ACCESSIBILITY. RELOCATE CREDIT CARD READER/POINT-OF-SALE MACHINE TO PROVIDE AT LEAST 30"/36" CLEAR LENGTH.
- AT PHARMACY WAITING AREA, CLEAR FLOOR SPACE AT BLOOD PRESSURE MACHINE OBSTRUCTED BY BEVERAGE COOLER. RELOCATE BEVERAGE COOLER TO A LOCATION WHERE A 30" X 48" CLEAR FLOOR SPACE CAN BE PROVIDED ADJACENT TO THE MACHINE FOR A PERSON IN A WHEELCHAIR TO MAKE A SIDE TRANSFER, OR REARRANGE POSITION OF THE B_M.
- PHOTO-LAB CHECKOUT SALES COUNTER CLEAR FLOOR SPACE OBSTRUCTED BY TIRED SHELVES. REMOVE A 48" SECTION OF COUNTER AND SHELVING DISPLAY BELOW AND INSTALL A 48" LONG SECTION OF ADA COMPLIANT COUNTER. INSTALL COMPLIANT SIGNAGE INCORPORATING THE INTERNATIONAL SYMBOL OF ACCESSIBILITY.
- PHARMACY CONSULTATION SERVICE COUNTER DOES NOT PROVIDE THE REQUIRED HEIGHT. THE ENTIRE COUNTER SURFACE MUST BE 36" MAXIMUM AFF. FORWARD APPROACH PORTION OF COUNTER SURFACE: 30" MINIMUM IN LENGTH AND 36" MAXIMUM AFF. WITH CLEAR FLOOR SPACE POSITIONED FOR FORWARD APPROACH (KNEE AND TOE SPACE REQUIRED): CONSULTATION COUNTER IS 39.75" AFF. INSTALL A COUNTER SUCH THAT A SECTION AT LEAST 30"/36" LONG IS NOT HIGHER THAN 36" AFF AND IS ON AN ACCESSIBLE ROUTE. REPAIR/REFINISH AS NEEDED.
- PHARMACY DROP-OFF COUNTER TOE CLEARANCE 34" AFF, 34" WIDE, 11.25" DEEP. ALCOVE DEPTH 12.25" CVS PHARMACY DROP-OFF COUNTER. INSTALL A NEW COMPLIANT DROP-OFF STATION AS INDICATED ON PLANS. PATCH FINISHES AS NEEDED.

DEMOLITION GENERAL NOTES

1. G.C. AND PROJECT MANAGER TO VERIFY ALL PROPOSED WORK AND MEASUREMENTS PRIOR TO CONSTRUCTION OR DEMOLITION.
2. REVIEW ENTIRE SET OF PLANS WITH PROJECT MANAGER BEFORE BEGINNING CONSTRUCTION. VERIFY ALL PHARMACY COMPONENTS THAT WILL BE RELOCATED.
3. G.C. RESPONSIBLE FOR RELOCATING RETAIL AREA SHELVING PER MERCHANDISE PLAN.

DEMOLITION LEGEND

- EXISTING TO BE REMOVED
- EXISTING TO REMAIN



STORE NUMBER: 5553
 101 BEN SAWYER BOULEVARD
 M.T. PLEASANT, SC 29464
 PROJECT TYPE: ADA and THH
 DEAL TYPE:
 CS PROJECT NUMBER: 106857

ARCHITECT OF RECORD

LITTLE
 www.littleonline.com
 The drawings and the design ideas are the property of Little Online Architectural Consulting. The reproduction, copying or other use of these drawings without their written consent is prohibited and any infringement will be subject to legal action.
 © Little 2017

CONSULTANT:



DEVELOPER:



SEAL:



REVISIONS:

NO.	DESCRIPTION

CVS PROJECT MANAGER: TS

DRAWING BY: JAC

DATE: 10-23-2017

JOB NUMBER: 121-7815-08

TITLE:

DEMOLITION PLAN

SHEET NUMBER:

AD1

COMMENTS: