




38 TYPICAL TENDON PROFILE
 NOTE: 1. WHEN THE LENGTH OF THE TOP REINFORCEMENT IS NOT INDICATED ON PLAN TAKE TOTAL LENGTH, AS INDICATED IN DETAIL # N.T.S.

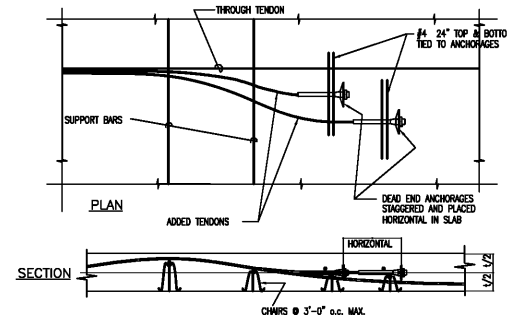

39 PLACEMENT OF ADDED TENDON IN CORROSIVE ENVIRONMENT
 N.T.S.

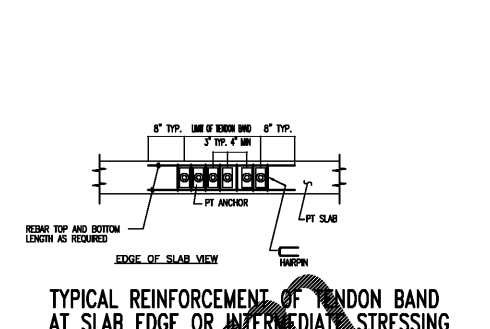


40 TYPICAL REINFORCEMENT OF TENDON BAND AT SLAB EDGE OR INTERMEDIATE STRESSING IN CORROSIVE ENVIRONMENT
 N.T.S.

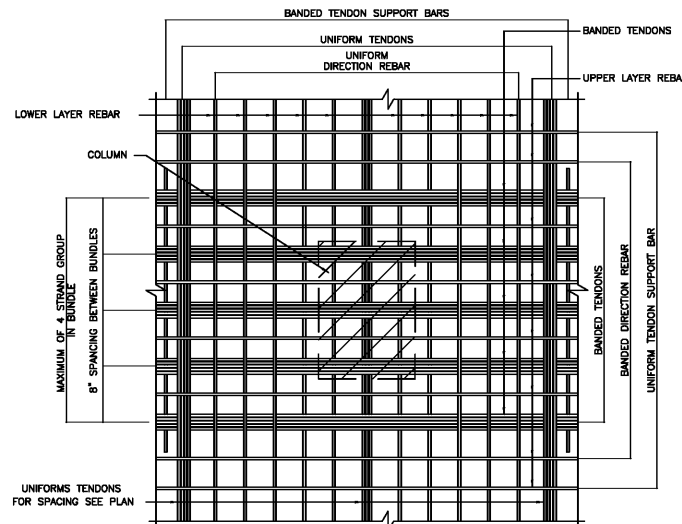


41 PLAN VIEW AT COLUMN
 UNIFORM TENDONS AT COLUMN CENTERLINE-TIED UNDER BANDED TENDONS N.T.S.


PLACEMENT SEQUENCE:
 1- PLACE UNIFORMS TENDONS (INSIDE OF COLUMNS)
 2- LOWER LAYER BARS
 3- PLACE BANDED TENDONS W/ UPPER LAYER BARS
 4- PLACE UNIFORMS TENDONS (OUTSIDE OF COLUMNS) UNDER UPPER LAYER BARS AND OVER BANDED TENDONS.

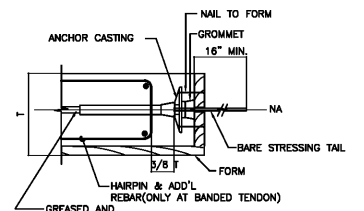


45 STRESSING END ANCHOR IN CORROSIVE ENVIRONMENT
 N.T.S.

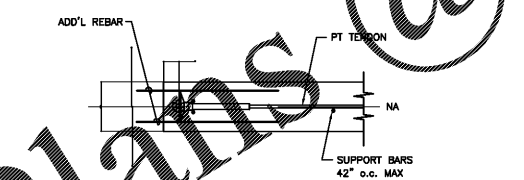


46 DEAD END IN CORROSIVE ENVIRONMENT
 N.T.S.

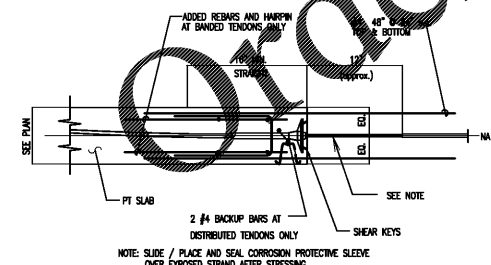


49 CONSTRUCTION JOINT WITH INTERMEDIATE STRESSING IN CORROSIVE ENVIRONMENT
 N.T.S.

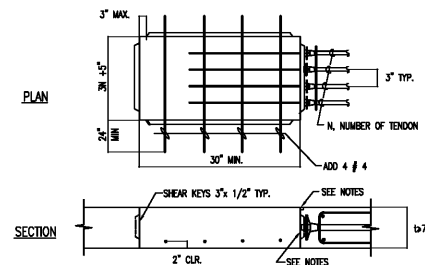


50 STRESSING BLOCKOUT IN CORROSIVE ENVIRONMENT
 N.T.S.

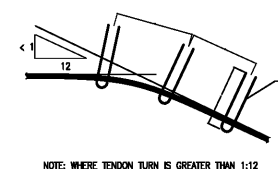


51 TENDON PLACEMENT FOR TURNS >1:12
 N.T.S.

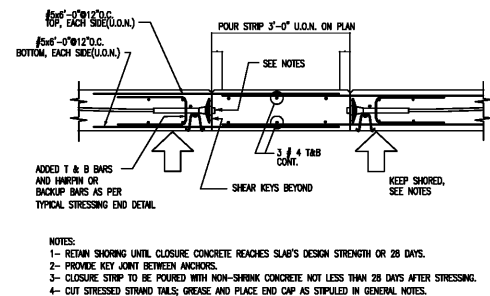


47 POUR STRIP IN SLAB FOR CORROSIVE ENVIRONMENT
 N.T.S.

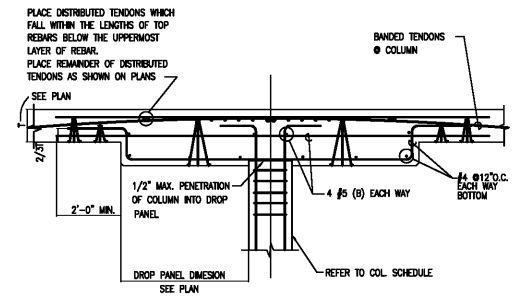


48 TYPICAL DROP PANEL SECTION
 N.T.S.

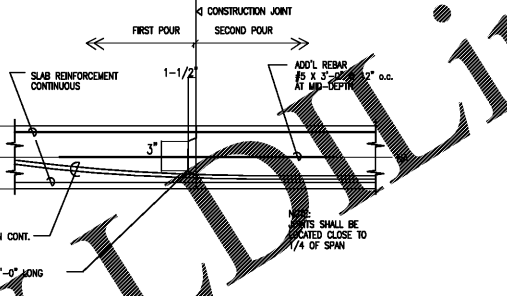



43 CONSTRUCTION JOINT WITH NO INTERMEDIATE STRESSING
 N.T.S.

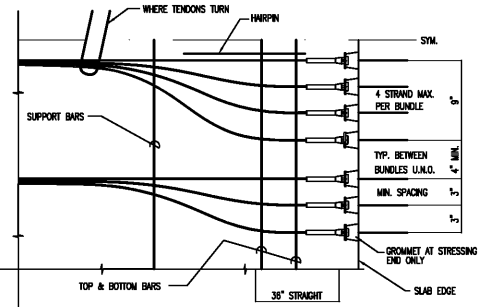

42 FLARING OF BANDED TENDONS AT SLAB EDGE IN CORROSIVE ENVIRONMENT
 N.T.S.

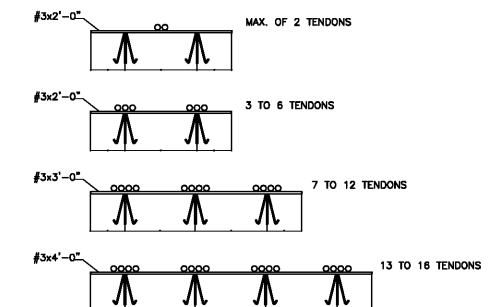

52 TYPICAL TENDON DISTRIBUTION AND SUPPORT DETAIL
 N.T.S.

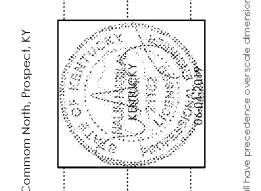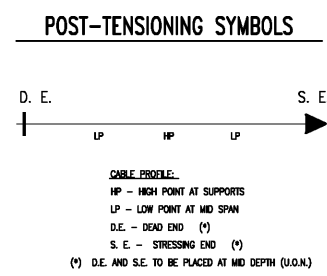

NALIN H. JOSHI, P.E.
 4321 MAYWOOD DRIVE
 JACKSONVILLE, FLORIDA 32277
 NALIN@YSHREE.COM
 (904) 744-6133

Norton Commons North - Apartments
 Prospect, Kentucky
 Bristol Development Group
 381 Mallory Station Rd, Suite 204
 Franklin, TN 37067

charlan • brock associates
 architects planners
 1770 fenell street
 maitland florida 32751-7208
 407.660.8900 F: 407.875.8948
 www.cbarchitects.com

STRUCTURAL
 STANDARD
 POST TENSION
 DETAILS

date: 06-04-2019
 job no: 37891.15
 drawn by: CDG
 reviewed by: NHJ
 file: 37895DT-76
 issue history:

Permit Set-06/04/2019

SDT-7D

C:\USERS\ADMINISTRATOR\DESKTOP\STRUCTURAL STUFF\37891 - NORTON COMMONS NORTH - PROSPECT - CONTACTS\37895DT-76.rvt
 Modified: 2019.03.27.18
 Author: 06/04/2019