


**SOUTH GREENVILLE POINT REPAIR PROJECT**  
 POINT REPAIR 20 - 29

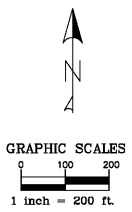


**LEGEND**

○ 699-100	MSSD SANITARY SEWER MANHOLE
—	MSSD SANITARY SEWER
—	SERVICE LATERALS
○	REWA SANITARY SEWER MANHOLE
- - -	REWA SANITARY SEWER
- - -	PROPERTY LINE
- - -	EDGE-OF-PAVEMENT
□	BUILDING FOOTPRINT
- - -	STREAM/EDGE-OF-WATER
—	NEW SERVICE LATERAL

Point Repair #	Start MH	End MH	Start MH Depth (ft)	End MH Depth (ft)	Length of Pipe (ft)	Pipe Diameter (in)	Location from Start MH (ft)	Pipe Material	Problem Summary	Service Position	Pre-CIPP	Repair	Repair Detail	Patch Detail
20	793-02	793-01	4.1	4.3	385.0	8	66.4	VCP	Service - Roots at Tee and Lateral	3		Pt. Repair (61.4 FT to 71.4 FT) - Install Tee and Lateral	2, 3, & 7	
21	793-03	793-04	5.6	5.4	304.3	6	5.0	VCP	Roots in Lateral			Replace to ROW	15	
22	793-03	793-04	8.3	9.1	304.3	8	171.4	VCP	Service - Offset Joint in Lateral	9		Pt. Repair using DIP (166.4 FT to 176.4 FT) - Install Tee and Lateral	2, 3, & 7	10
23	793-04	793-05	8.3	8.3	24.1	6	5.0	VCP	Offset Joint - Small	1		Replace to ROW	15	10
24	793-16	793-17	5.2	5.5	147.5	8	103.1	VCP	Service - No Visible Defects	3	*	Pt. Repair (98.1 FT to 108.1 FT) - Install Tee and Lateral	2, 3, & 7	14
25	793-16	793-17	5.5	5.5	147.5	8	62.4	VCP	Service - Capped	3	*	Pt. Repair (57.4 FT to 67.4 FT) - Install Tee and Lateral	2, 3, & 7	14
26	793-16	793-15	5.2	5.0	220.2	8	96.9	VCP	Service - Offset at 4 x 6	9		Pt. Repair (91.9 FT to 101.9 FT) - Install Tee and Lateral	2, 3, & 7	14
27	793-26	793-25	8.2	7.8	295.1	8	209.8	VCP	Service - Roots at Tee and Lateral	9		Pt. Repair (204.8 FT to 214.8 FT) - Install Tee and Lateral	2, 3, & 7	10
28	793-10	793-09	13.2	8.0	166.0	8	93.0	VCP	Service - Roots at Tee and Lateral	3		Pt. Repair (88.0 FT to 98.0 FT) - Install Tee and Lateral	2, 3, & 7	14
29	793-20	793-20	5.8	4.7	356.4	8	222.9	VCP	Service - Roots at Tee and Lateral	9		Pt. Repair (217.9 FT to 227.9 FT) - Install Tee and Lateral	2, 3, & 7	10

NOTE:  
 SERVICE LATERALS ARE SHOWN FOR INFORMATION PURPOSES ARE APPROXIMATELY BASED ON CCTV DATA AND MANHOLE INSPECTIONS. NOT ALL EXISTING SERVICES ARE SHOWN. ALL SERVICES TO BE REPAIRED ARE SHOWN.

Approval:   
 Date: 1-29-2018  
 Checked: JLD  
 Drawn:  
 Scale: 1"=200'  
 Project Number: 16-4005  
 Sheet: C-5

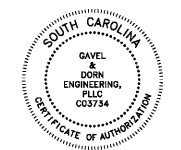

PROJECT	SHEET TITLE	MARK	DATE	DESCRIPTION