


K
J
H
G
F
E
D
C
B
A

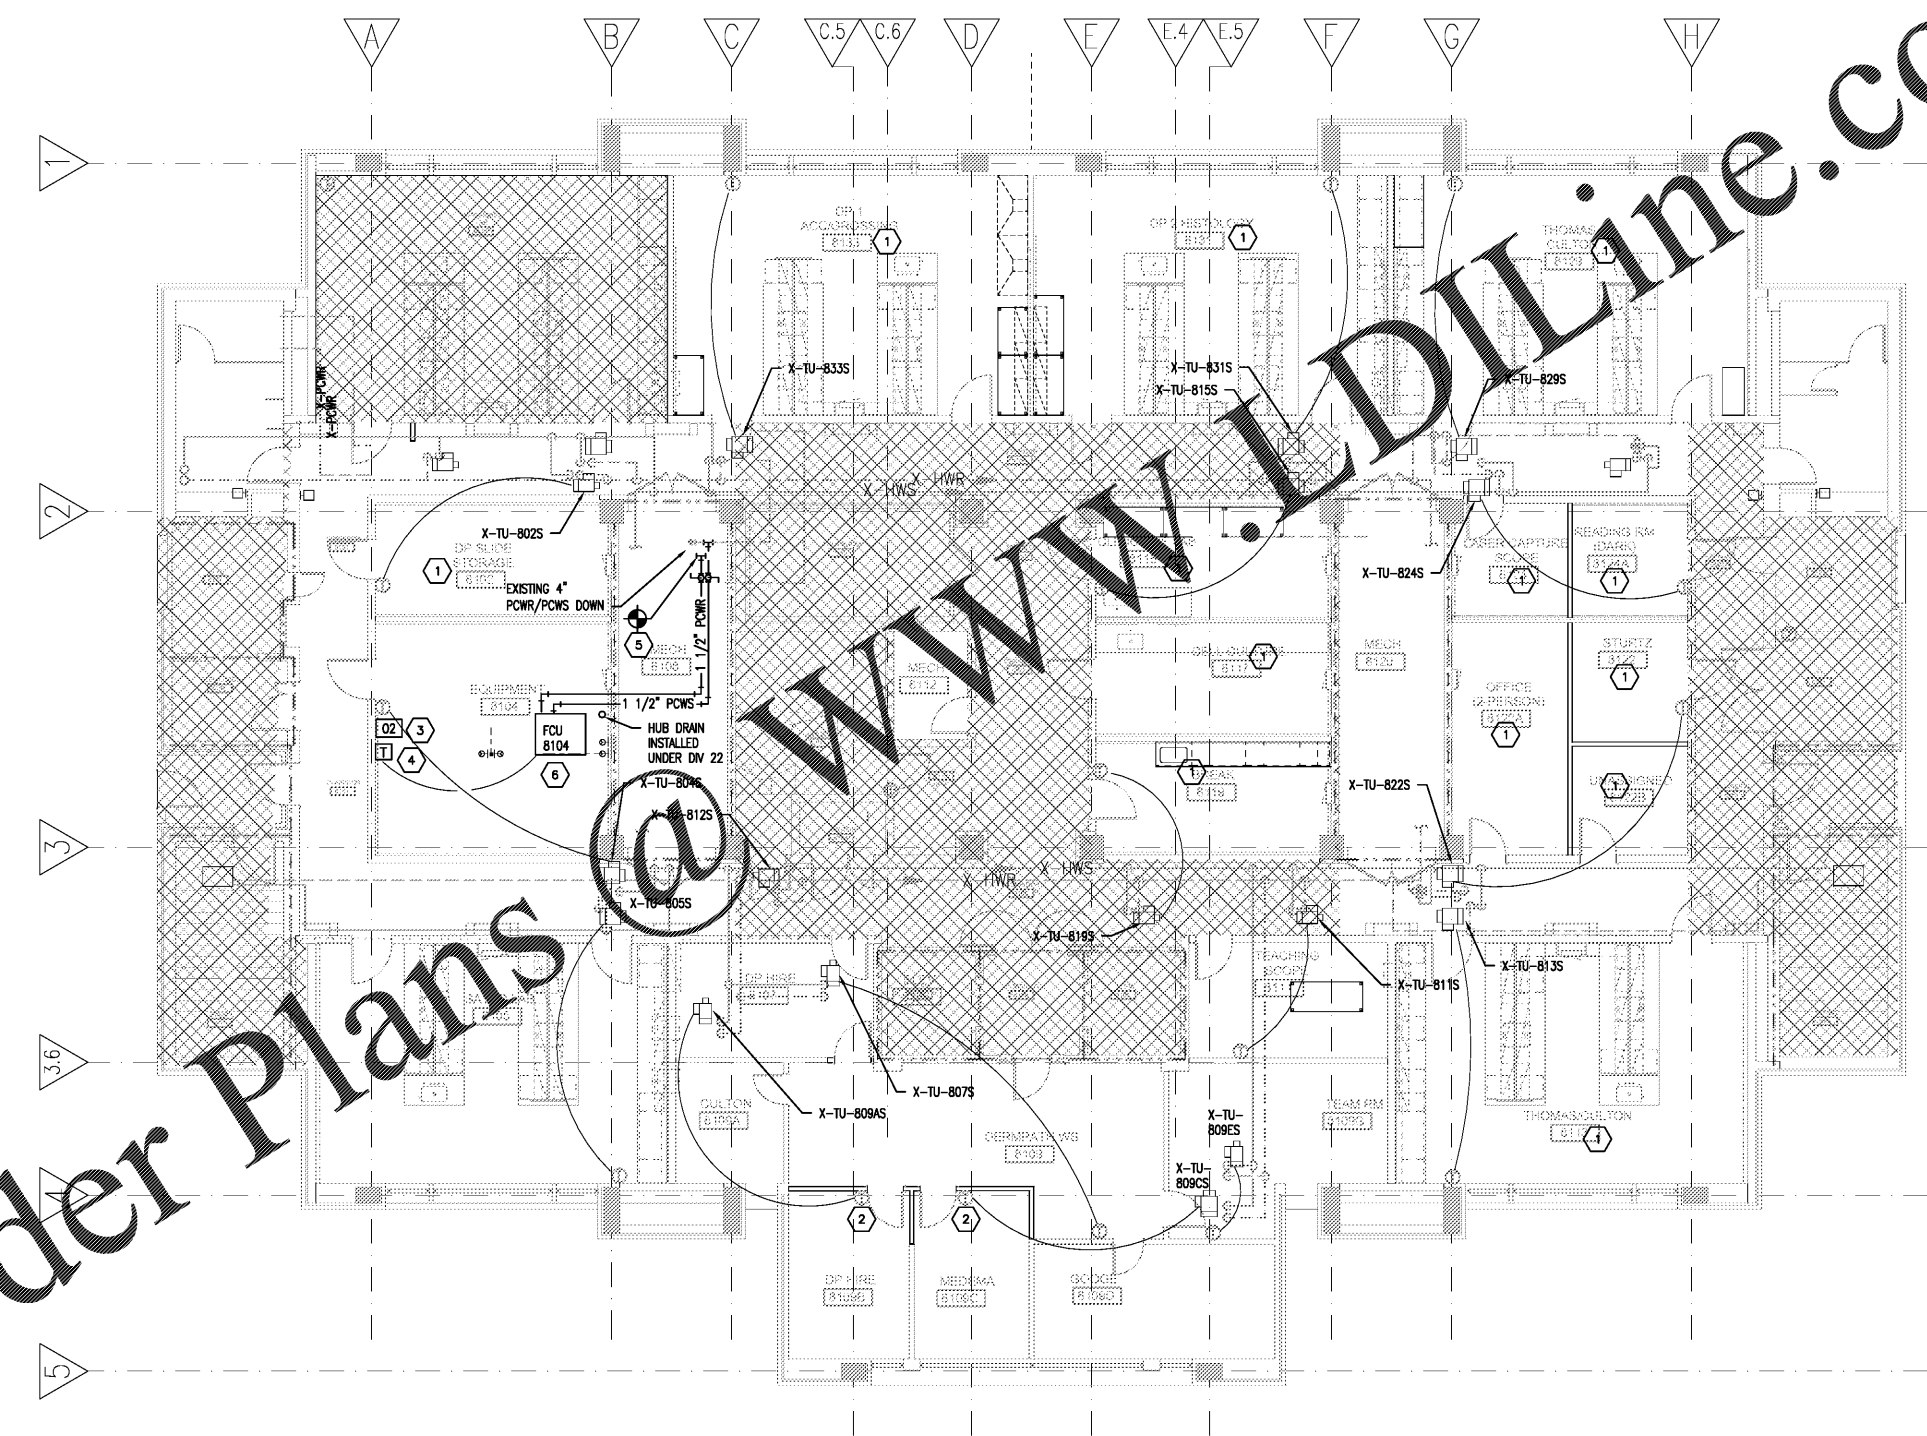

Order Plans @ WWW.DIline.com

- GENERAL NOTES**
- RE-CALIBRATE SENSORS AND CONTROLS ASSOCIATED WITH ALL TERMINAL REHEAT UNITS WHERE AIR FLOW BALANCE IS INDICATED. REPORT DEFECTIVE CONTROLLERS OR SENSORS TO ENGINEER. EXISTING CONTROLLERS AND SENSORS ARE BY JOHNSON CONTROLS.
 - GRAPHICS SHALL BE UPDATED TO REFLECT ANY CHANGES TO ROOM ID OR CONFIGURATION.

- SHEET KEYED NOTES**
- NO PIPING WORK, THIS ROOM.
 - RELOCATION THERMOSTAT TO LOCATION INDICATED.
 - OXYGEN DEPLETION MONITOR SHALL BE LOCATED IN ROOM WITH BULK NITROGEN STORAGE OR WHERE NITROGEN MAY BE DISPENSED. MONITOR SHALL PROVIDE A LOCAL AUDIO-VISUAL ALARM AND ALSO ALARM CAMPUS PUBLIC SAFETY OFFICE AND BAS IF OXYGEN LEVELS DROP BELOW 18%. MOUNT ADJACENT TO AND AT SAME ELEVATION AS THERMOSTAT.
 - FAN COIL UNIT THERMOSTAT SETPOINT SHALL BE 2'F HIGHER THAN TERMINAL BOX SETPOINT.
 - INTERCEPT EXISTING PROCESS CHILLED WATER PIPING VIA WET TAP TO AVOID THE NEED TO DRAIN THE SYSTEM.
 - EXTEND MINIMUM 1" CONDENSATE DRAIN TO HUB DRAIN.

PARTITION AND WALL LEGEND

	1-HOUR FIRE BARRIER
	2-HOUR FIRE BARRIER

1 EIGHTH FLOOR PLAN - MECHANICAL PIPING
M118 1/8" = 1'-0"



LORD AECK SARGENT
A KATERRA COMPANY

© 2018 Lord Aeck Sargent. All rights reserved. This document is the property of Lord Aeck Sargent and is to be returned upon demand. The information contained herein may not be used or divulged without the written permission of Lord Aeck Sargent.

Kramer Engineering Services, plc
5517 Cascade Dr.
Chapel Hill, NC 27514
TEL: (919) 933-3350
email: Donna@AESplc.com
Firm License: P-1099

REVISION

UNC SCHOOL OF MEDICINE
NEUROSCIENCES RESEARCH BUILDING
7th & 8th FLOORS FOR DERMATOLOGY
LOCATION
115 Mason Farm Road, Campus Box 7250
Chapel Hill, North Carolina 27598-7250

ISSUE DATE
09/25/2019
JOB NO.
10761-00
DWG. NO.
M118

SCALE (INCH) 1/8" = 1'-0"
1/8" = 1'-0"
0 4 8 16 FT

BID SET